Honeywell

Gamewell FCI

Safety Bulletin

Date: February 2019 No. S19.1

To: Gamewell-FCI Engineered Systems Distributors

* * * Important Safety Notice for Gamewell-FCI Distributors * * *
Immediate Action Required

Smoke response
ASD-PL3-IV, ASD-PL3R-IV, ASD-PTL3-IV detectors
operating in CLIP mode and connected to the S3 Series or E3 Series Fire Alarm Control Panels (FACP)

Issue:

ASD-PL3-IV (Photo in Classic Ivory), ASD-PL3R-IV (Photo Remote Test in Classic Ivory), ASD-PTL3-IV (Photo Thermal in Classic Ivory) detectors manufactured from March 30, 2018 to January 14, 2019 (date codes 8034 to 9013), operating in CLIP mode and connected to the S3 Series or E3 Series Fire Alarm Control Panels are affected.

This **specified configuration** will not properly indicate or annunciate a fire alarm condition in certain fire scenarios such as a fast, flaming fire.

This Safety Bulletin is being conducted in cooperation with the U.S. Consumer Product Safety Commission

Description:

The above referenced smoke detectors are capable of operating in either Velociti™ or CLIP mode and with other Gamewell-FCI Fire Alarm Control Panels. However, it is only the **specified configuration** that will not properly indicate or annunciate a fire alarm condition in certain fire scenarios and, therefore, should NOT be used.

Detectors used in the above specified configuration should be replaced immediately


Engineered Systems Distributors, please return all shelf stock of the above models through normal channels.

WARNING: ASD-PL3-IV, ASD-PL3R-IV ASD-PTL3-IV detectors within the above date range can NEVER be configured as CLIP with S3 Series, E3 Series Fire Alarm Control Panels. Detectors used in this configuration will not properly indicate or annunciate a fire alarm condition in certain fire scenarios such as fast, flaming fire.

Products affected by this bulletin that are used in the **specified configuration** need to be returned to the point of purchase for replacement or credit. Please contact your point of purchase to coordinate the product return.

Gamewell-FCI has taken the appropriate steps to prevent recurrence and units manufactured after 9013 are not affected. Our goal is to resolve this issue as efficiently as possible and we apologize for the inconvenience.

Example product label

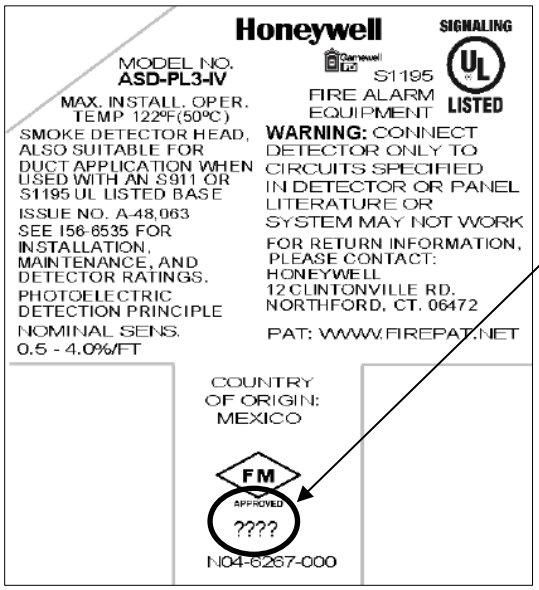

4-digit date code

Example carton label

