GENT
by Honeywell


Technical Bulletin	TB 10173

To: Gent by Honeywell, System Integrators	Date: 4/2/11
	Status: Active
	Type: SI

Product – Part affected:
Commissioning tool v1.27, Service pack 1

Details:

1. Comm. tool 1.27 and MCC v4.43 / 3.97. If all the headings are ticked but not all the loops are selected, then unselected loops will have their zones/groups & sector information deleted.

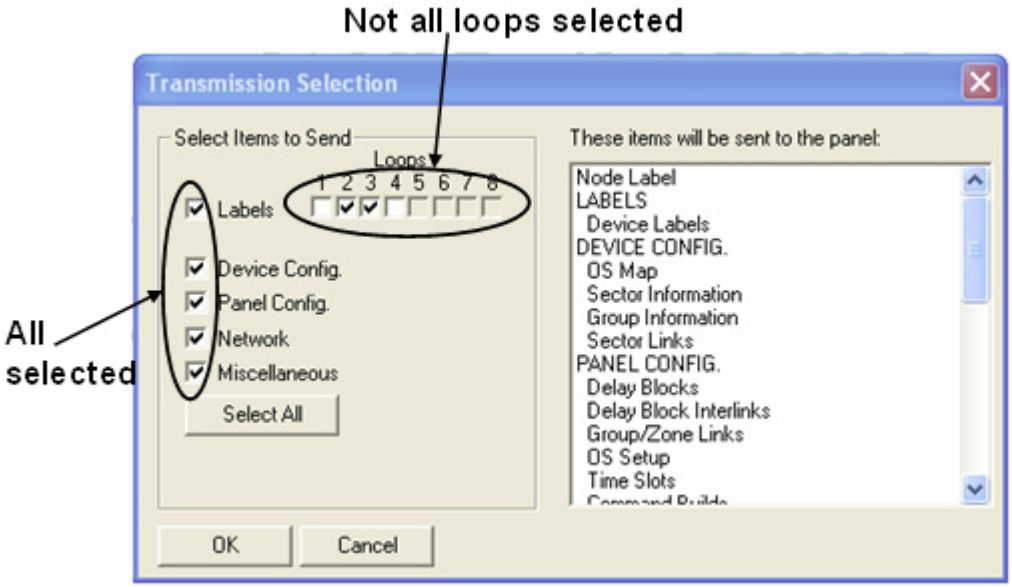

2. Delay block linking missing off higher numbers loops. If you have a system with gaps in your loop numbers then delay block linking for the loops after the missing loop will not be retrieved.

Action:
Both of these issues have been fixed in a service pack that can be installed onto commissioning tool v1.27 only.
Comm. tool v1.27 service pack 1 can be downloaded from www.Gentexpert.co.uk (download section, software, commissioning tool).
Please ensure all engineers running comm. tool v1.27 upgrade to service pack 1.

We recommend that engineers check their configuration files that have been done using v1.27:

- Where delay block linking is used to ensure all delay block linking is present
- Visit sites where uploads have been done but not all site data was selected to be uploaded.

Name: Peter Dodge