MPR SERIES

MicroPressure Board Mount Pressure Sensors Compact, High Accuracy, Compensated/Amplified

DESCRIPTION

The MPR Series is a very small piezoresistive silicon pressure sensor offering a digital output for reading pressure over the specified full scale pressure span and temperature range. It is calibrated and compensated over a specific temperature range for sensor offset, sensitivity, temperature effects, and non-linearity using an on-board Application Specific Integrated Circuit (ASIC). This product is designed to meet the requirements of higher volume medical (consumer and non-consumer) devices, commercial appliance, and industrial/HVAC applications.

APPLICATIONS

- **Consumer medical** Non-invasive blood pressure monitoring, negativepressure wound therapy, breast pumps, mobile oxygen concentrators, airflow monitors, CPAP water tanks, and medical wearables
- Non-consumer medical Invasive blood pressure monitors, ambulatory blood pressure measurement, urine analyzers
- Industrial Air braking systems, gas and water meters, natural gas metering, process gas monitoring, gas burner control, air compressors, gray water tank level measurement
- **Consumer** Coffee machines, humidifiers, air beds, washing machines, dishwashers
- **Transportation** CNG level monitoring, fuel level measurement



VALUE TO CUSTOMERS

- Very small form factor Enables portability by addressing weight, size, and space restrictions; occupies less area on the PCB
- Wide pressure ranges simplify use
- Enhances performance Output accelerates performance through reduced conversion requirements and direct interface to microprocessors
- Value solution Cost-effective, higher volume solution with configurable options
- Meets IPC/JEDEC J-STD-020D.1 Moisture Sensitivity Level 2 — Allows avoidance of thermal and mechanical damage during solder reflow attachment and/or repair that lesser rated sensors may incur; allows long floor life when stored as specified (simplifying storage and reducing scrap); eliminates lengthy bakes prior to reflow, and allows for lean manufacturing due to stability and usability shortly after reflow
- Meets food safety certification for North America, Europe, and Asia (see Table 2)

DIFFERENTIATION

- Application-specific design addresses various application needs and challenges
- Digital output Plug and play feature enables ease of implementation and system level connectivity
- Total Error Band Provides a more comprehensive measurement of performance over the compensated temperature range, which minimizes testing and calibrating every sensor, thereby potentially reducing manufacturing cost; improves sensor accuracy and offers ease of sensor interchangeability due to minimal part-to-part variation. (See Figure 1.)



32332628

Issue I

FEATURES

- 5 mm × 5 mm [0.20 in × 0.20 in] package footprint
- Calibrated and compensated
- 60 mbar to 2.5 bar | 6 kPa to 250 kPa | 1 psi to 30 psi
- 24-bit digital I²C or SPI-compatible output
- IoT (Internet of Things) ready interface
- Stainless steel pressure port
- Compatible with a variety of liquid media
- Absolute and gage pressure types
- Total Error Band after customer autozero — As low as ±1.25 % FSS
- Compensated temperature range 0°C to 50°C [32°F to 122°F]
- REACH and RoHS compliant
- Meets IPC/JEDEC J-STD-020D.1 Moisture Sensitivity Level 2
- Select sensors available on breakout board for easy evaluation and testing
- Ultra-low power consumption (as low as 0.01 mW typ. average power, 1 Hz measurement frequency)
- Sensor materials have been tested and certified for these food safety standards — BPA Free, LFGB, NSF-169

PORTFOLIO

The MPR Series joins an extensive line of board mount pressure sensors for potential use in medical, industrial, and consumer applications. To view the entire product portfolio, click here.



TABLE OF CONTENTS

| 4 | General Specifications | | | | | | |
|--|--|---|--|--|--|--|--|
| 5 | Pow | Power Consumption and Standby Mode | | | | | |
| 7 | Product Nomenclature and Order Guide | | | | | | |
| 8 | Cor | Core Parts | | | | | |
| 9 10 11 11 | 60 r 6 kF 1 ps | Pressure Range Specifications 60 mbar to 2.5 bar 6 kPa to 250 kPa 1 psi to 30 psi 0 mmHg to 300 mmHg | | | | | |
| 12 | 1.0 | General Information | | | | | |
| 12 | 2.0 | Pinout and Functionality | | | | | |
| 12 | 3.0 | Start-Up Timing | | | | | |
| 13 | 4.0 | Power Supply Requirement | | | | | |
| 13 13 13 | 5.1 | Reference Circuit Design I2C and SPI Circuit Diagrams Bypass Capacitor Use | | | | | |
| 14 14 14 15 15 15 15 15 16 | 6.1 6.2 6.3 6.4 6.5 | I2C Communications I2C Bus Configuration I2C Data Transfer I2C Sensor Address I2C Pressure Reading I2C Status Byte I2C Communications 6.6.1 Output Measurement Command 6.6.2 I2C Sensor Address of 0×18 | | | | | |
| 16 | 6.7 | I2C Timing and Level Parameters | | | | | |
| 17 | 6.8 | Reference Code (Arduino/Genuino Uno) for I2C Interface | | | | | |
| 18 18 18 19 19 19 20 | 7.1 7.2 7.3 7.4 7.5 7.6 | SPI Data Transfer SPI Pressure Reading SPI Status Byte SPI Communications | | | | | |

- 21 8.0 MPR Series Digital Output Pressure Calculation
- 22 Long Port Dimensions and Recommended PCB Pad Layout
- 23 Short Port Dimensions and Recommended PCB Pad Layout
- 24 Tape and Reel Dimensions
- 25 Reflowable Protective Silicone Cap
- 25 Reflowable Protective Silicone Cap Removal
- 25 Recommended Tubing
- 26 Recommended O-Rings
- Back cover Additional Information


TOTAL ERROR BAND

Total Error Band (TEB) is a single specification that includes the major sources of sensor error. TEB should not be confused with accuracy, which is actually a component of TEB. TEB is the worst error that the sensor could experience.

Honeywell uses the TEB specification in its datasheet because it is the most comprehensive measurement of a sensor's true accuracy. Honeywell also provides the accuracy specification in order to provide a common comparison with competitors' literature that does not use the TEB specification.

Many competitors do not use TEB—they simply specify the accuracy of their device. Their accuracy specification, however, may exclude certain parameters. On their datasheet, the errors are listed individually. When combined, the total error (or what would be TEB) could be significant.

Figure 1. TEB Components for the MPR Series

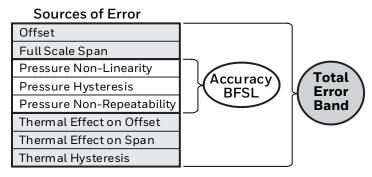

| TABLE 1. ABSOLUTE MAXIMUM RATINGS ¹ | | | | | | | | |
|--|-----------|---------------------------|---------|--|--|--|--|--|
| Characteristic | Minimum | Maximum | Unit | | | | | |
| Supply voltage (V _{supply}) | -0.3 | 3.6 | Vdc | | | | | |
| Voltage on any pin | -0.3 | V _{supply} + 0.3 | V | | | | | |
| ESD susceptibility (human body model) | _ | 4 | kV | | | | | |
| Storage temperature | -40 [-40] | 85 [185] | °C [°F] | | | | | |
| Soldering peak reflow temperature and time | | 15 s max. at 250°C [482°F |] | | | | | |

¹Absolute maximum ratings are the extreme limits the device will withstand without damage.

| TABLE 2. ENVIRONMENT | TABLE 2. ENVIRONMENTAL SPECIFICATIONS | | | | | |
|---|---|--|--|--|--|--|
| Characteristic | Parameter | | | | | |
| Humidity: external surfaces internal surfaces | 0 %RH to 95 %RH, non-condensing 0 %RH to 100 %RH, condensing | | | | | |
| Vibration | 10 g, 10 Hz to 2 kHz | | | | | |
| Shock | 50 g, 6 ms duration | | | | | |
| Life ² | 1 million pressure cycles, minimum | | | | | |
| Solder reflow | J-STD-020E, MSL 2 (see shelf/floor life) (unlimited shelf life when stored at ≤30°C/85 %RH) | | | | | |
| Shelf life | Unlimited storage life, inside sealed moisture barrier bag | | | | | |
| Floor life ³ | One year floor life, after removal from sealed moisture bag, ≤30°C/60 %RH | | | | | |
| Certification (food grade gel coating option) | NSF-169, BPA Free, LFGB | | | | | |

²Life may vary depending on specific application in which the sensor is utilized.

³ Floor life, the maximum recommended time period after removal from a moisture barrier bag or dry storage prior to solder reflow. If the maximum recommended floor time is exceeded parts may require to be baked at 55°C for up to 12 hours prior to solder reflow.

| TABLE 3. WETTED MATERIALS | | | | |
|---------------------------|---|--|--|--|
| Component | Material | | | |
| Port | 304 stainless steel | | | |
| Adhesives | epoxy, silicone gel, fluorosilicone gel | | | |
| Electronic components | silicon, glass, gold, aluminum | | | |
| Metal gel ring | 304 stainless steel | | | |

| TABLE 4. SENSOR PRESSURE TYPES | | | | |
|--------------------------------|---|--|--|--|
| Pressure Type | Description | | | |
| Absolute | Output is proportional to the difference between applied pressure and a built-in vacuum reference. | | | |
| Gage | Output is proportional to the difference between applied pressure and atmospheric (ambient) pressure. | | | |

| TABLE 5. OPERATING SPECIFICATIONS | TABLE 5. OPERATING SPECIFICATIONS | | | | | | | |
|---|-----------------------------------|--------------|--------------|--------------------|--|--|--|--|
| Characteristic | Minimum | Typical | Maximum | Unit | | | | |
| Supply voltage (V _{supply}):1 | 1.8 | 3.3 | 3.6 | Vdc | | | | |
| Current consumption: I ² C sleep/standby mode SPI sleep/standby mode | 3.0 13.0 | 33.8 43.8 | 211 221.0 | nA nA | | | | |
| Power consumption | - | 10 | — | mW | | | | |
| Operating temperature range ² | -40 [-40] | - | 85 [185] | °C [°F] | | | | |
| Compensated temperature range ³ | 0 [32] | — | 50 [122] | °C [°F] | | | | |
| Startup time (power up to data ready) | — | — | 2.5 | ms | | | | |
| Data rate (assumes command AA _{HEX}) | 161 | 204 | _ | samples per second | | | | |
| I ² C/SPI voltage level: low high | _ 80 | | 20 | $0/_{o}V_{supply}$ | | | | |
| Pull up on MISO, SCLK, SS, MOSI | 1 | — | — | kOhm | | | | |
| Accuracy ⁴ | _ | _ | ±0.25 | % FSS BFSL⁵ | | | | |
| Resolution: transfer function A transfer function B transfer function C | 14.0 13.5 14.0 | - - - | - - - | bits | | | | |

¹The sensor is not reverse polarity protected. Incorrect application of supply voltage or ground to the wrong pin may cause electrical failure.

²Operating temperature range: The temperature range over which the sensor will produce an output proportional to pressure.

³Compensated temperature range: The temperature range over which the sensor will produce an output proportional to pressure within the specified performance limits (Total Error Band).

⁴Accuracy: The maximum deviation in output from a Best Fit Straight Line (BFSL) fitted to the output measured over the pressure range. Includes all errors due to pressure non-linearity, pressure hysteresis, and non-repeatability.


⁵Full Scale Span (FSS): The algebraic difference between the output signal measured at the maximum (Pmax.) and minimum (Pmin.) limits of the pressure range. (See Figure 4 for pressure ranges.)

POWER CONSUMPTION AND STANDBY MODE

The sensor is normally in Standby Mode and is only turned on in response to a user command, thus minimizing power consumption. Upon receiving the user command, the sensor wakes up from Standby Mode, runs a measurement in Active State, and automatically returns to Standby Mode, awaiting the next command. The resulting sensor power consumption is a function of the sampling rate (samples per second) as shown in Tables 6 and 7 and Figures 2 and 3.

| TABLE 6. AVERAGE POWER CONSUMPTION AT 1.8 V _{SUPPLY} (ASSUMES COMMAND AA _{HEX}) | | | | | | | | | | | |
|--|-----------------------|---------------------|-----------------------|-------------------|--------------------|--|--|--|--|--|--|
| Sampling Rate (samples per second) | Average Power (mW) | Active Time (ms) | Aactive Power (mW) | Idle Time (ms) | Idle Power (mW) | | | | | | |
| Minimum Average Power | | | | | | | | | | | |
| 1 | 0.0068 | 3.625 | 1.884 | 996.375 | 0.0000054 | | | | | | |
| 2 | 0.0137 | 7.25 | 1.884 | 992.75 | 0.0000054 | | | | | | |
| 5 | 0.0341 | 18.125 | 1.884 | 981.875 | 0.0000054 | | | | | | |
| 10 | 0.0683 | 36.25 | 1.884 | 963.75 | 0.0000054 | | | | | | |
| 20 | 0.1366 | 72.5 | 1.884 | 963.75 | 0.0000054 | | | | | | |
| 50 | 0.3414 | 181.25 | 1.884 | 818.75 | 0.0000054 | | | | | | |
| 100 | 0.6829 | 362.5 | 1.884 | 637.5 | 0.0000054 | | | | | | |
| 160 | 1.0926 | 580 | 1.884 | 420 | 0.0000054 | | | | | | |
| | | Typical Averag | e Power | | | | | | | | |
| 1 | 0.0094 | 4.157 | 2.248 | 995.843 | 0.00006084 | | | | | | |
| 2 | 0.0187 | 8.314 | 2.248 | 991.686 | 0.00006084 | | | | | | |
| 5 | 0.0468 | 20.785 | 2.248 | 979.215 | 0.00006084 | | | | | | |
| 10 | 0.0935 | 41.57 | 2.248 | 958.43 | 0.00006084 | | | | | | |
| 20 | 0.1870 | 83.14 | 2.248 | 916.86 | 0.00006084 | | | | | | |
| 50 | 0.4673 | 207.85 | 2.248 | 792.15 | 0.00006084 | | | | | | |
| 100 | 0.9345 | 415.7 | 2.248 | 584.3 | 0.00006084 | | | | | | |
| 160 | 1.4592 | 665.12 | 2.248 | 334.88 | 0.00006084 | | | | | | |
| | | Maximum Avera | age Power | | | | | | | | |
| 1 | 0.0129 | 4.839 | 2.588 | 995.161 | 0.0003798 | | | | | | |
| 2 | 0.0254 | 9.678 | 2.588 | 990.322 | 0.0003798 | | | | | | |
| 5 | 0.0630 | 24.195 | 2.588 | 975.805 | 0.0003798 | | | | | | |
| 10 | 0.1256 | 48.39 | 2.588 | 951.61 | 0.0003798 | | | | | | |
| 20 | 0.2508 | 96.78 | 2.588 | 903.22 | 0.0003798 | | | | | | |
| 50 | 0.6264 | 241.95 | 2.588 | 758.05 | 0.0003798 | | | | | | |
| 100 | 1.2524 | 483.9 | 2.588 | 516.1 | 0.0003798 | | | | | | |
| 160 | 2.0036 | 774.24 | 2.588 | 225.76 | 0.0003798 | | | | | | |

Figure 2. AVERAGE Power Consumption vs Sampling Rate at 1.8 $V_{\mbox{\tiny supply}}$

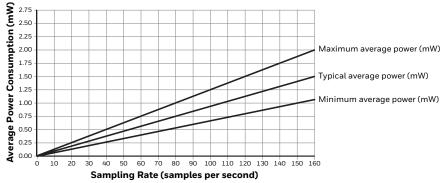

| Sampling Rate (Samples per second) | Average Power | | | | | | | | | | |
|--|---------------|---------------------|----------------------|-------------------|--------------------|--|--|--|--|--|--|
| (campies per second) | (mW) | Active Time (ms) | Active Power (mW) | Idle Time (ms) | Idle Power (mW) | | | | | | |
| Minimum Average Power | | | | | | | | | | | |
| 1 | 0.0114 | 3.625 | 3.134 | 996.375 | 0.000099 | | | | | | |
| 2 | 0.0227 | 7.25 | 3.134 | 992.75 | 0.000099 | | | | | | |
| 5 | 0.0568 | 18.125 | 3.134 | 981.875 | 0.000099 | | | | | | |
| 10 | 0.1136 | 36.25 | 3.134 | 963.75 | 0.000099 | | | | | | |
| 20 | 0.2272 | 72.5 | 3.134 | 963.75 | 0.000099 | | | | | | |
| 50 | 0.5680 | 181.25 | 3.134 | 818.75 | 0.000099 | | | | | | |
| 100 | 1.1361 | 362.5 | 3.134 | 637.5 | 0.000099 | | | | | | |
| 160 | 1.8177 | 580 | 3.134 | 420 | 0.0000099 | | | | | | |
| | | Typical Averag | je Power | | | | | | | | |
| 1 | 0.0156 | 4.157 | 3.729 | 995.843 | 0.00011154 | | | | | | |
| 2 | 0.0311 | 8.314 | 3.729 | 991.686 | 0.00011154 | | | | | | |
| 5 | 0.0776 | 20.785 | 3.729 | 979.215 | 0.00011154 | | | | | | |
| 10 | 0.1551 | 41.57 | 3.729 | 958.43 | 0.00011154 | | | | | | |
| 20 | 0.3101 | 83.14 | 3.729 | 916.86 | 0.00011154 | | | | | | |
| 50 | 0.7751 | 207.85 | 3.729 | 792.15 | 0.00011154 | | | | | | |
| 100 | 1.5501 | 415.7 | 3.729 | 584.3 | 0.00011154 | | | | | | |
| 160 | 2.4800 | 665.12 | 3.729 | 334.88 | 0.00011154 | | | | | | |
| | | Maximum Avera | age Power | | | | | | | | |
| 1 | 0.0214 | 4.839 | 4.275 | 995.161 | 0.0006963 | | | | | | |
| 2 | 0.0421 | 9.678 | 4.275 | 990.322 | 0.0006963 | | | | | | |
| 5 | 0.1041 | 24.195 | 4.275 | 975.805 | 0.0006963 | | | | | | |
| 10 | 0.2075 | 48.39 | 4.275 | 951.61 | 0.0006963 | | | | | | |
| 20 | 0.4144 | 96.78 | 4.275 | 903.22 | 0.0006963 | | | | | | |
| 50 | 1.0349 | 241.95 | 4.275 | 758.05 | 0.0006963 | | | | | | |
| 100 | 2.0692 | 483.9 | 4.275 | 516.1 | 0.0006963 | | | | | | |
| 160 | 3.3103 | 774.24 | 4.275 | 225.76 | 0.0006963 | | | | | | |

Figure 3. Average Power Consumption vs Sampling Rate at 3.3 $V_{\mbox{\tiny supply}}$


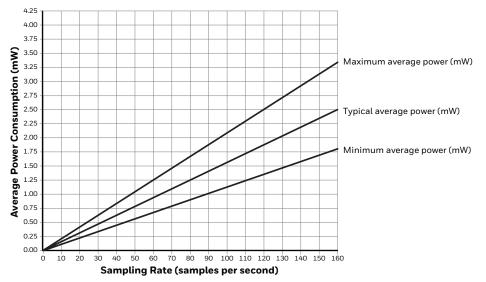


Figure 4. Product Nomenclature AND ORDER GUIDE

For example, **MPRLS0025PA00001A** defines an MPR Series pressure sensor, long port, silicone gel, 0 psi to 25 psi absolute pressure range, I²C, address 0x18, 10% to 90% of 2²⁴ counts transfer function, no breakout board.

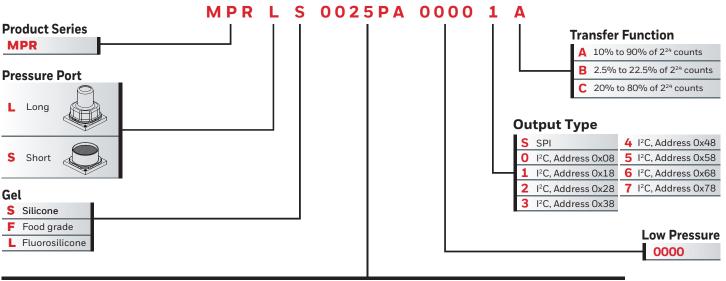

Pressure Range, Unit and Reference¹

| Absolute | Absolute | Absolute | |
|----------------------------------|--------------------------------|--------------------------------|----------------------------------|
| 0001BA 0 bar to 1 bar | 0100KA 0 kPa to 100 kPa | 0015PA 0 psi to 15 psi | |
| 01.6BA 0 bar to 1.6 bar | 0160KA 0 kPa to 160 kPa | 0025PA 0 psi to 25 psi | |
| 02.5BA 0 bar to 2.5 bar | 0250KA 0 kPa to 250 kPa | 0030PA 0 psi to 30 psi | |
| Gage | Gage | Gage | Gage |
| 0060MG 0 mbar to 60 mbar | 0006KG 0 kPa to 6 kPa | 0001PG 0 psi to 1 psi | 0300YG 0 mmHg to 300 mmHg |
| 0100MG 0 mbar to 100 mbar | 0010KG 0 kPa to 10 kPa | 0005PG 0 psi to 5 psi | |
| 0160MG 0 mbar to 160 mbar | 0016KG O kPa to 16 kPa | 0015PG 0 psi to 15 psi | |
| 0250MG 0 mbar to 250 mbar | 0025KG 0 kPa to 25 kPa | 0030PG 0 psi to 30 psi | |
| 0400MG 0 bar to 400 mbar | 0040KG 0 kPa to 40 kPa | | |
| 0600MG 0 bar to 600 mbar | 0060KG 0 kPa to 60 kPa | N inH₂0 | |
| 0001BG 0 bar to 1 bar | 0100KG 0 kPa to 100 kPa | G MPa Other calibration | |
| 01.6BG 0 bar to 1.6 bar | 0160KG 0 kPa to 160 kPa | H HPa units may be specified. | |
| 02.5BG 0 bar to 2.5 bar | 0250KG 0 kPa to 250 kPa | $C \text{ cmH}_2\text{O}$ | |

¹ Custom pressure ranges are available. Contact Honeywell Customer Service for more information.

CORE PARTS - RECOMMENDED FOR NEW DESIGNS

The MPR Series Core Parts list has been created to simplify the selection of sensors for our channel partners and customers. Core parts are recommended for new designs, they are competitively priced and are stocked by key Honeywell channel partners for rapid sampling

| TABLE 9. CORE PARTS | |
|---------------------|---|
| Part Number | Product Description |
| MPRLF0001PGN001SC | MicroPressure MPR, 69 mbar [1 psi], differential, SMTL, long port, digital I²C, 3.3 V, liquids/gases |
| MPRLF0160MG00001A | MicroPressure MPR, 160 mbar [2.3 psi], gage, SMTL, long port, digital I²C, 3.3 V, liquids/gases |
| MPRLF0160MG0000SA | MicroPressure MPR, 160 mbar [2.3 psi], gage, SMTL, long port, digital SPI, I²C, liquids/gases |
| MPRLS0001PG00001C | MicroPressure MPR, 69 mbar [1 psi], gage, SMTL, long port, digital I 2 C, 3.3 V, liquids/gases |
| MPRLS0001PG0000SC | MicroPressure MPR, 69 mbar [1 psi], gage, SMTL, long port, digital SPI, 3.3 V, liquids/gases |
| MPRLS0015PA0000SA | MicroPressure MPR, 1.04 bar [15 psi], absolute, SMTL, long port, digital SPI, 3.3 V, liquids/gases |
| MPRLS0015PG00001A | MicroPressure MPR, 1.04 bar [15 psi], gage, SMTL, long port, digital I²C, 3.3 V, liquids/gases |
| MPRLS0015PG0000SA | MicroPressure MPR, 1.04 bar [15 psi], gage, SMTL, long port, digital SPI, I²C, liquids/gases |
| MPRLS0025PA00002A | MicroPressure MPR, 1.72 bar [25 psi], absolute, SMTL, long port, digital I 2 C, 3.3 V, liquids/gases |
| MPRLS0025PA0000SA | MicroPressure MPR, 1.72 bar [25 psi], absolute, SMTL, long port, digital SPI, I²C, liquids/gases |
| MPRLS0030PG00000A | MicroPressure MPR, 2.07 bar [30 psi], gage, SMTL, long port, digital I²C, 3.3 V, liquids/gases |
| MPRLS0030PG0000SA | MicroPressure MPR, 2.07 bar [30 psi], gage, SMTL, long port, digital SPI, I²C, liquids/gases |
| MPRLS0300YG00001B | MicroPressure MPR, 300 mmHg [440 mbar], gage, SMTL, long port, digital SPI, 3.3 V, liquids/gases |
| MPRSS0250KA00000A | MicroPressure MPR, 2.5 bar [36.3 psi], absolute, SMTL, short port, digital I 2 C, 3.3 V, liquids/gases |
| MPRSS0250KA00000C | MicroPressure MPR, 2.5 bar [36.3 psi], absolute, SMTL, short port, digital SPI, 3.3 V, liquids/gases |

MPR BREAKOUT BOARDS

Breakout boards, designed for use with the Honeywell SEK002 Sensor Evaluation Kit, are available with the sensor already mounted.

MPR Series with long port mounted on a breakout board. MPR Series with short port mounted on a breakout board.



TABLE 8. ORDER GUIDE FOR MPR SERIES SENSOR ON BREAKOUT BOARD

Catalog Listing MPRLS0025PA00001AB MPRLS0015PA0000SAB MPRLS0300YG00001BB MPRSS0001PG00001CB

Description

Breakout board with 0 psi to 25 psi absolute sensor, long port, with gel, I^2C = 0x18, transfer function A Breakout board with 0 psi to 15 psi absolute sensor, long port, with gel, SPI, transfer function A Breakout board with 0 mmHg to 300 mmHg gage sensor, long port, with gel, I^2C = 0x18, transfer function B Breakout board with 0 psi to 1 psi gage sensor, short port, with gel, $I^2C = 0x18$, transfer function C

| TABLE 10. PRESSURE RANGE SPECIFICATIONS FOR 60 MBAR TO 2.5 BAR | | | | | | | | |
|--|------------------------------|-------------------------------|------|-------------------------------|--------------------------------|---|--|----------------------|
| Pressure Range (See Figure 4.) | Pressur P _{MIN.} | Pe Range P _{MAX.} | Unit | Over Pressure ¹ | Burst Pressure ² | Total Error Band After Customer Auto-Zero ³ (% FSS) | Total Error Band, Typical (% FSS) | Transfer Function |
| | | | | Absolut | e | | | |
| 0001BA | 0 | 1 | bar | 4 | 8 | ±1.54 | ±1.5 | A, B |
| 01.6BA | 0 | 1.6 | bar | 4 | 8 | ±1.54 | ±1.5 | A, B |
| 02.5BA | 0 | 2.5 | bar | 4 | 8 | ±1.54 | ±1.5 | A, B |
| | | | | Gage | | | | |
| 0060MG | 0 | 60 | mbar | 350 | 700 | ±1.25 | ±2.5 | С |
| 0100MG | 0 | 100 | mbar | 350 | 700 | ±1.25 | ±2.5 | С |
| 0160MG | 0 | 160 | mbar | 350 | 700 | ±1.25 | ±2.5 | С |
| 0250MG | 0 | 250 | mbar | 350 | 700 | ±1.25 | ±2.5 | С |
| 0400MG | 0 | 400 | mbar | 4000 | 8000 | ±2.0 | ±2.5 | A, B |
| 0600MG | 0 | 600 | mbar | 4000 | 8000 | ±2.0 | ±2.5 | A, B |
| 0001BG | 0 | 1 | bar | 4 | 8 | ±1.5 | ±2.5 | A, B |
| 01.6BG | 0 | 1.6 | bar | 4 | 8 | ±1.5 | ±2.5 | A, B |
| 02.5BG | 0 | 2.5 | bar | 4 | 8 | ±1.5 | ±2.5 | A, B |

¹**Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range. The customer's pressure connection system (tubing or O-rings) must be specified to be equal to, or greater than, the rated overpressure limit. Due to the possibility of light sensitivity, opaque tubing is recommended.

² **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.

- ³Total Error Band after Customer Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span. Low pressure MPR sensors may exhibit offset shifts after reflow solder. See Technical Note "Auto-Zero Calibration Technique for Pressure Sensors" (008326-1-EN) if this shift is significant in a particular application.
- ⁴ Because atmospheric pressure is continually changing, autozeroing an absolute pressure sensor requires a reference standard. If the actual absolute pressure is important in an application (such as for a barometer), an external precision reference is needed to set the offset to the correct current value of atmospheric pressure. In applications where the difference between multiple absolute sensors is important, any reference may be used (such as one of the other absolute pressure sensors in a system, or even an arbitrary pressure like 14.7 psia), as long as it is consistent and repeatable.

| TABLE 11. PRESSURE RANGE SPECIFICATIONS FOR 6 KPA TO 250 KPA | | | | | | | | |
|--|------------------------------|------------------------------|------|-------------------|--------------------------------|---|--|----------------------|
| Pressure Range (See Figure 4.) | Pressur P _{MIN.} | e Range Р _{мах.} | Unit | Over Pressure¹ | Burst Pressure ² | Total Error Band After Customer Auto-Zero ³ (% FSS) | Total Error Band, Typical (% FSS) | Transfer Function |
| | | | | Absolut | te | | | |
| 0100KA | 0 | 100 | kPa | 400 | 800 | ±1.54 | ±1.5 | A, B |
| 0160KA | 0 | 160 | kPa | 400 | 800 | ±1.54 | ±1.5 | A, B |
| 0250KA | 0 | 250 | kPa | 400 | 800 | ±1.54 | ±1.5 | A, B |
| | | | | Gage | | | | |
| 0006KG | 0 | 6 | kPa | 35 | 70 | ±1.25 | ±2.5 | С |
| 0010KG | 0 | 10 | kPa | 35 | 70 | ±1.25 | ±2.5 | С |
| 0016KG | 0 | 16 | kPa | 35 | 70 | ±1.25 | ±2.5 | С |
| 0025KG | 0 | 25 | kPa | 35 | 70 | ±1.25 | ±2.5 | С |
| 0040KG | 0 | 40 | kPa | 400 | 800 | ±2.0 | ±2.5 | A, B |
| 0060KG | 0 | 60 | kPa | 400 | 800 | ±2.0 | ±2.5 | A, B |
| 0100KG | 0 | 100 | kPa | 400 | 800 | ±1.5 | ±2.5 | A, B |
| 0160KG | 0 | 160 | kPa | 400 | 800 | ±1.5 | ±2.5 | A, B |
| 0250KG | 0 | 250 | kPa | 400 | 800 | ±1.5 | ±2.5 | A, B |

¹**Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range. The customer's pressure connection system (tubing or O-rings) must be specified to be equal to, or greater than, the rated overpressure limit. Due to the possibility of light sensitivity, opaque tubing is recommended.

² **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.

- ³Total Error Band after Customer Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span. Low pressure MPR sensors may exhibit offset shifts after reflow solder. See Technical Note "Auto-Zero Calibration Technique for Pressure Sensors" (008326-1-EN) if this shift is significant in a particular application.
- ⁴ Because atmospheric pressure is continually changing, autozeroing an absolute pressure sensor requires a reference standard. If the actual absolute pressure is important in an application (such as for a barometer), an external precision reference is needed to set the offset to the correct current value of atmospheric pressure. In applications where the difference between multiple absolute sensors is important, any reference may be used (such as one of the other absolute pressure sensors in a system, or even an arbitrary pressure like 14.7 psia), as long as it is consistent and repeatable.

| TABLE 12. PRESSURE RANGE SPECIFICATIONS FOR 1 PSI TO 30 PSI | | | | | | | | |
|---|-------------------|-------------------|------|-------------------------------|--------------------------------|---|-----------------------------|----------------------|
| Pressure | Pressur | e Range | | | | Total Error Band | Total Error | |
| Range (See Figure 4.) | P _{MIN.} | P _{MAX.} | Unit | Over Pressure ¹ | Burst Pressure ² | After Customer Auto-Zero³ (% FSS) | Band, Typical (% FSS) | Transfer Function |
| Absolute | | | | | | | | |
| 0015PA | 0 | 15 | psi | 60 | 120 | ±1.54 | ±1.5 | A, B |
| 0025PA | 0 | 25 | psi | 60 | 120 | ±1.54 | ±1.5 | A, B |
| 0030PA | 0 | 30 | psi | 60 | 120 | ±1.54 | ±1.5 | A, B |
| | | | | Gage | | | | |
| 0001PG | 0 | 1 | psi | 5 | 10 | ±1.25 | ±2.5 | С |
| 0005PG | 0 | 5 | psi | 60 | 120 | ±2.0 | ±2.5 | A, B |
| 0015PG | 0 | 15 | psi | 60 | 120 | ±1.5 | ±2.5 | A, B |
| 0030PG | 0 | 30 | psi | 60 | 120 | ±1.5 | ±2.5 | A, B |

¹**Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range. The customer's pressure connection system (tubing or O-rings) must be specified to be equal to, or greater than, the rated overpressure limit. Due to the possibility of light sensitivity, opaque tubing is recommended.

² **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.

- ³ Total Error Band after Customer Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span. Low pressure MPR sensors may exhibit offset shifts after reflow solder. See Technical Note "Auto-Zero Calibration Technique for Pressure Sensors" (008326-1-EN) if this shift is significant in a particular application.
- ⁴ Because atmospheric pressure is continually changing, autozeroing an absolute pressure sensor requires a reference standard. If the actual absolute pressure is important in an application (such as for a barometer), an external precision reference is needed to set the offset to the correct current value of atmospheric pressure. In applications where the difference between multiple absolute sensors is important, any reference may be used (such as one of the other absolute pressure sensors in a system, or even an arbitrary pressure like 14.7 psia), as long as it is consistent and repeatable.

| TABLE 13. PRE | SSURE RAI | NGE SPECI | FICATIONS | FOR 0 MMHG | то 300 ммн | G | | |
|-----------------------------|-------------------|-------------------|-----------|-------------------------------|--------------------------------|---|-----------------------------|----------------------|
| Pressure | Pressur | e Range | | | | Total Error Band | Total Error | |
| Range (See Figure 4.) | P _{MIN.} | P _{MAX.} | Unit | Over Pressure ¹ | Burst Pressure ² | After Customer Auto-Zero ³ (% FSS) | Band, Typical (% FSS) | Transfer Function |
| Gage | | | | | | | | |
| 0300YG | 0 | 300 | mmHg | 3100 | 6200 | ±2.0 | ±2.5 | В |

¹**Overpressure:** The maximum pressure which may safely be applied to the product for it to remain in specification once pressure is returned to the operating pressure range. Exposure to higher pressures may cause permanent damage to the product. Unless otherwise specified this applies to all available pressure ports at any temperature with the operating temperature range. The customer's pressure connection system (tubing or O-rings) must be specified to be equal to, or greater than, the rated overpressure limit. Due to the possibility of light sensitivity, opaque tubing is recommended.


² **Burst Pressure:** The maximum pressure that may be applied to any port of the product without causing escape of pressure media. Product should not be expected to function after exposure to any pressure beyond the burst pressure.

³Total Error Band after Customer Auto-Zero: The maximum deviation from the ideal transfer function over the entire compensated pressure range for a minimum of 24 hours after an auto-zero operation. Includes all errors due to full scale span, pressure non-linearity, pressure hysteresis, and thermal effect on span. Low pressure MPR sensors may exhibit offset shifts after reflow solder. See Technical Note "Auto-Zero Calibration Technique for Pressure Sensors" (008326-1-EN) if this shift is significant in a particular application.

1.0 GENERAL INFORMATION

Please see pages 19-22 for product dimensions, pinouts, tape and reel dimensions, Recommended Pick and Place Geometry, and recommended tubing.

2.0 PINOUT AND FUNCTIONALITY (SEE TABLE 14.)

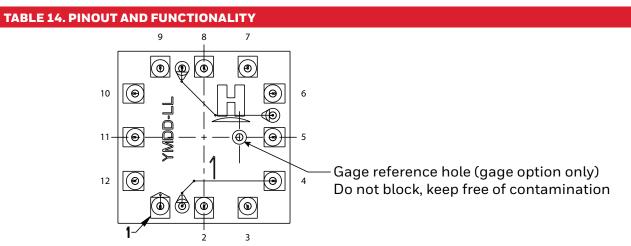

| Pad Number | Name | Description |
|---------------|-----------------|---|
| 1 | SS | Sensor Select: Chip select for SPI sensor |
| 2 | MOSI/SDA | Master Out Sensor In: Data in for SPI sensor; data in/out for I ² C sensor |
| 3 | SCLK/SCL | Clock input for SPI and I ² C sensor |
| 4 | VO+ | $V_{\text{OUT+}}$ pin in piezoresistive Wheatstone Bridge: Anti-aliasing filter can be connected between VO+ and VO- |
| 5 | NC | No connection |
| 6 | VO- | $V_{\text{OUT-}}$ pin in piezoresistive Wheatstone Bridge: Anti-aliasing filter can be connected between VO- and VO+ |
| 7 | MISO | Master In Sensor Out: Data output for SPI sensor |
| 8 | EOC | End-of-conversion indicator: This pin is set high when a measurement and calculation have been completed and the data is ready to be clocked out |
| 9 | RES | Reset: This pin can be connected and used to control safe resetting of the sensor. RES is active-low; a $V_{DD}-V_{SS}-V_{DD}$ transition at the RES pin leads to a complete sensor reset |
| 10 | V _{SS} | Ground reference voltage signal |
| 11 | NC | No connection |
| 12 | V _{DD} | Positive supply voltage |

3.0 START-UP TIMING

On power-up, the MPR Series sensor is able to receive the first command after 1 ms from when the VDD supply is within operating specifications. The MPR Series sensor can begin the first measurement after 2.5 ms from when the VDD supply is operational. Alternatively, instead of a power-on reset, a reset and new power-up sequence can be triggered by an IC-reset signal (high low) at the RES pin.

4.0 POWER SUPPLY REQUIREMENT

Verify that system power to the sensor meets the VDD rising slope requirement (minimum VDD rising slope is at least 10 V/ms). If not, use the RES pin to bring the sensor out of reset once the system power has stabilized.

5.0 REFERENCE CIRCUIT DESIGN

5.1 I²C and SPI Circuit Diagrams (See Figures 5 and 6.)

Figure 5. I²C Circuit Diagram


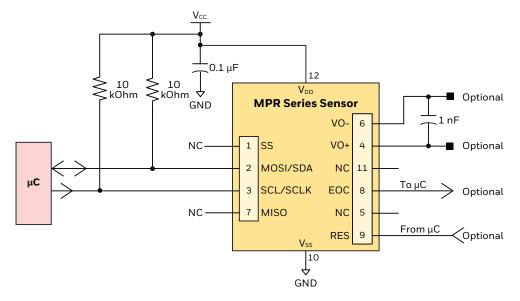


Figure 6. SPI Circuit Diagram

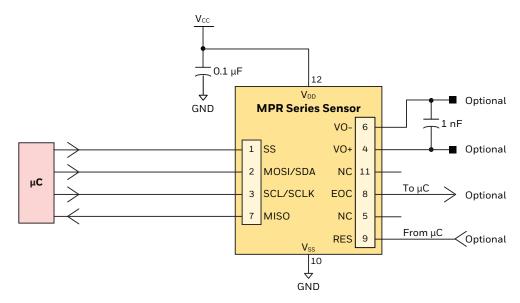

5.2 Bypass Capacitor Use

NOTICE

Ensure bypass capacitors are integrated into the end user design to ensure output noise suppression.

6.0 I²C COMMUNICATIONS


6.1 I²C Bus Configuration (See Figure 7.)

The I²C bus is a simple, serial 8-bit oriented computer bus for efficient I²C (Inter-IC) control. It provides good support for communication between different ICs across short circuit-board distances, such as interfacing microcontrollers with various low speed peripheral devices. For detailed specifications of the I²C protocol, see Rev. 6 (April 2014) of the I²C Bus Specification (source: NXP Semiconductor at https://www.nxp.com/docs/en/user-guide/UM10204.pdf).

Each device connected to the bus is software addressable by a unique address and a simple Master/Sensor relationship that exists at all times. The output stages of devices connected to the bus are designed around an open collector architecture. Because of this, pull-up resistors to $+V_{DD}$ must be provided on the bus. Both SDA and SCL are bidirectional lines, and it is important to system performance to match the capacitive loads on both lines. In addition, in accordance with the I²C specification, the maximum allowable capacitance on either line is 400 pF to ensure reliable edge transitions at 400 kHz clock speeds.

When the bus is free, both lines are pulled up to $+V_{DD}$. Data on the I²C bus can be transferred at a rate up to 100 kbit/s in the standard-mode, or up to 400 kbit/s in the fast-mode.

Figure 7. I²C Bus Configuration

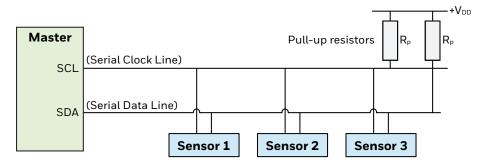

6.2 I²C Data Transfer

The MPR Series I²C Sensors will only respond to requests from a Master device. Following the address and read bit from the Master, the MPR Series Sensors are designed to output up to 4 bytes of data. The first data byte is the Status Byte (8-bit) and the second to fourth bytes are the compensated pressure output (24-bit).

6.3 I²C Sensor Address

Each MPR Series I²C Sensor is referenced on the bus by a 7-bit sensor address. The default address for the MPR Series is 24 (0×18). Other available standard addresses are: 08 (0×08), 40 (0×28), 56 (0×38), 72 (0×48), 88 (0×58), 104 (0×68), 120 (0×78). (Other custom values are available. Please contact Honeywell Customer Service with questions regarding custom Sensor addresses.)

6.4 I²C Pressure Reading

To read out a compensated pressure reading, the Master generates a START condition and sends the Sensor address followed by a read bit (1). After the Sensor generates an acknowledge, it will transmit up to 4 bytes of data. The first data byte is the Status Byte (8-bit) and the second to fourth bytes are the compensated pressure output (24-bit). The Master must acknowledge the receipt of each byte, and can terminate the communication by sending a Not Acknowledge (NACK) bit followed by a Stop bit after receiving the required bytes of data.

6.5 I²C Status Byte (See Table 15.)

| TABLE 15. I ² C STATUS BYTE EXPLANATION | | | | | |
|--|--|---|--|--|--|
| Bit (Meaning) | Status | Comment | | | |
| 7 | always O | - | | | |
| 6 (Power indication) | 1 = device is powered 0 = device is not powered | Needed for the SPI Mode where the Master reads all zeroes if the device is not powered or in power-on reset (POR). | | | |
| 5 (Busy flag) | 1 = device is busy | Indicates that the data for the last command is not yet available. No new commands are processed if the device is busy. | | | |
| 4 | always O | - | | | |
| 3 | always O | - | | | |
| 2 (Memory integrity/error flag) | 0 = integrity test passed 1 = integrity test failed | Indicates whether the checksum-based integrity check passed or failed; the memory error status bit is calculated only during the power-up sequence. | | | |
| 1 | always O | - | | | |
| 0 (Math saturation) | 1 = internal math saturation has occurred | _ | | | |

6.6 I²C Communications


6.6.1 I²C Output Measurement Command

To communicate with the MPR Series I²C output sensor using an Output Measurement Command of "O×AA", followed by "O×OO" "O×OO", follow the steps shown in Table 16. This command will cause the device to exit Standby Mode and enter Operating Mode. At the conclusion of the measurement cycle, the device will automatically re-enter Standby Mode.

| TABLE 16. I ² C OUTPUT MEASUREMENT COMMAND | | | | | | |
|---|--|---|--|--|--|--|
| Step | | Action | | Notes | | |
| 1 | S SensorAddr O A Command A Conc 7-bit | Master to Sensor Sensor to Master | | | | |
| 2 | Option 1: Wait until the busy flag in the Status Byte clears. S SensorAddr 1 A Status N P 7-bit Read bit | Option 2: Wait for at least 5 ms for the data conversion to occur. | Option 3: Wait for the EOC indicator. | S Start condition P Stop condition A Acknowledge | | |
| 3 | To read the 24-bit pressure output along with the 8-bit Status Byte: S SensorAddr 1 A SensorDat A SensorDat N P 7-bit Read bit | | | | | |


6.6.2 I²C Sensor Address of 0×18

To communicate with the MPR Series I²C output sensor with an I²C Sensor Address of 0×18 (hex), follow the steps shown in Table 17.

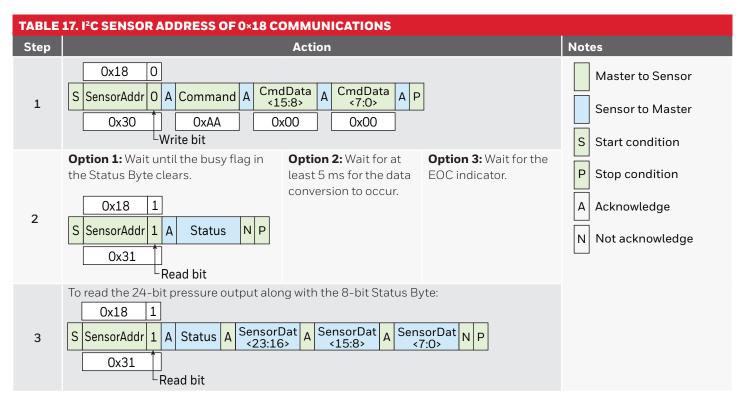

6.7 I²C Timing and Level Parameters (See Table 18.)

TABLE 18. I²C BUS TIMING DIAGRAM AND PARAMETERS

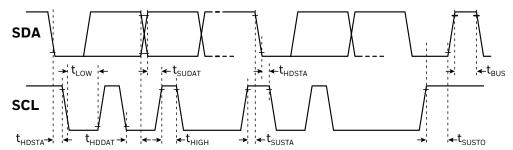

| Characteristic | Abbreviation | Min. | Тур. | Max. | Unit |
|--|---------------------|------|------|------|-----------------|
| SCLK clock frequency | f _{SCL} | 100 | _ | 400 | kHz |
| Start condition hold time relative to SCL edge | t _{hdsta} | 0.1 | _ | _ | μs |
| Minimum SCLK clock low width ¹ | t _{LOW} | 0.6 | — | — | μs |
| Minimum SCLK clock high width ¹ | t _{HIGH} | 0.6 | _ | _ | μs |
| Start condition setup time relative to SCL edge | t _{susta} | 0.1 | — | — | μs |
| Data hold time on SDA relative to SCL edge | thddat | 0 | _ | _ | μs |
| Data setup time on SDA relative to SCL edge | t _{sudat} | 0.1 | — | — | μs |
| Stop condition setup time on SCL | t _{susto} | 0.1 | _ | _ | μs |
| Bus free time between stop condition and start condition | t _{BUS} | 2 | — | — | μs |
| Output level low | Out _{low} | _ | 0 | 0.2 | V _{DD} |
| Output level high | Out _{high} | 0.8 | 1 | — | V _{DD} |
| Pull-up resistance on SDA and SCL | Rp | 1 | _ | 50 | kOhm |

¹Combined low and high widths must equal or exceed minimum SCLK period.

6.8 Reference Code (Arduino/Genuino Uno) for I2C Interface

See also Section 8.0 for details and examples of MPR Series Pressure output calculations.


```
#include<Arduino.h>
#include<Wire.h>
uint8_t id = 0x28; // i2c address
uint8 t data[4]; // holds output data
uint8_t cmd[3] = {0xAA, 0x00, 0x00}; // command to be sent
double press counts = 0; // digital pressure reading [counts]
double pressure = 0; // pressure reading [bar, psi, kPa, etc.]
double outputmax = 15099494; // output at maximum pressure [counts]
double outputmin = 1677722; // output at minimum pressure [counts]
double pmax = 1; // maximum value of pressure range [bar, psi, kPa, etc.]
double pmin = 0; // minimum value of pressure range [bar, psi, kPa, etc.]
double percentage = 0; // holds percentage of full scale data
char printBuffer[200], cBuff[20], percBuff[20], pBuff[20];
void setup() {
  Serial.begin(9600);
  while (!Serial) {
    delay(10);
  }
  Wire.begin();
  sprintf(printBuffer, "\nStatus Register, 24 - bit Sensor data, Digital Pressure Counts,\
           Percentage of full scale pressure, Pressure Output\n");
  Serial.println(printBuffer);
}
void loop() {
  Wire.beginTransmission(id);
  int stat = Wire.write (cmd, 3); // write command to the sensor
  stat |= Wire.endTransmission();
  delay(10);
  Wire.requestFrom(id, 4); // read back Sensor data 4 bytes
  int i = 0;
  for (i = 0; i < 4; i++) {</pre>
    data [i] = Wire.read();
  }
  press_counts = (double)((int32_t)data[3]+(int32_t)data[2]*(int32_t)256+
  (int32 t)data[1]*(int32 t)65536); // calculate digital pressure counts
  percentage = (press_counts / 16777215) * 100; // calculate pressure as percentage of full scale
  //calculation of pressure value according to equation 2 of datasheet
  pressure = ((press counts - outputmin) * (pmax - pmin)) / (outputmax - outputmin) + pmin;
  dtostrf(press_counts, 4, 1, cBuff);
  dtostrf(percentage, 4, 3, percBuff);
  dtostrf(pressure, 4, 3, pBuff);
  /*
    The below code prints the raw data as well as the processed data
    Data format : Status Register, 24-bit Sensor Data, Digital Counts, percentage of full scale
pressure,
    pressure output
  sprintf(printBuffer, " % x\t % 2x % 2x % 2x\t % s\t % s\t % s\t % s\n", data[0], data[1], data[2],
          data[3],
          cBuff, percBuff, pBuff);
 Serial.print(printBuffer);
  delay(10);
}
```

7.0 SPI COMMUNICATIONS

7.1 SPI Definition

The Serial Peripheral Interface (SPI) is a simple bus system for synchronous serial communication between one Master and one or more Sensors. It operates either in full-duplex or half-duplex mode, allowing communication to occur in either both directions simultaneously, or in one direction only. The Master device initiates an information transfer on the bus and generates clock and control signals. Sensors are controlled by the Master through individual Sensor Select (SS) lines and are active only when selected. The MPR Series SPI sensors operate in full-duplex mode only, with data transfer from the Sensor to the Master. This data transmission uses four, unidirectional bus lines. The Master controls SCLK, MOSI and SS; the Sensor controls MISO. (See Figure 8.)


Figure 8. SPI Bus Configuration

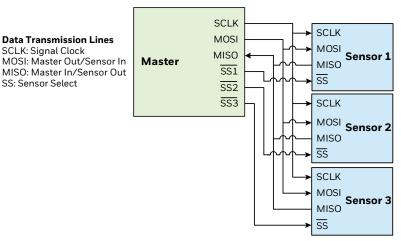

7.2 SPI Data Transfer

Start communication with the MPR Series SPI sensors by de-asserting the Sensor Select (SS) line. At this point, the sensor is no longer idle, and will begin sending data once a clock is received. MPR Series SPI sensors are configured for SPI operation in mode 0 (clock polarity is 0 and clock phase is 0). (See Figure 9.)

Figure 9. Example of 1 Byte SPI Data Transfer

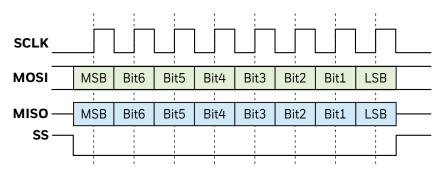

Once the clocking begins, the MPR Series SPI sensor is designed to output up to 4 bytes of data. The first data byte is the Status Byte (8-bit) and the second to fourth bytes are the compensated pressure output (24-bit).

7.3 SPI Pressure Reading

To read out a compensated pressure reading, the Master generates the necessary clock signal after activating the sensor with the Sensor Select (SS) line. The sensor will transmit up to 4 bytes of data. The first data byte is the Status Byte (8-bit) and the second to fourth bytes are the compensated pressure output (24-bit). The Master can terminate the communication by stopping the clock and deactivating the SS line.

7.4 SPI Status Byte

The SPI status byte contains the bits shown in Table 19.


7.5 SPI Communication

To communicate with the MPR Series SPI output sensor using an Output Measurement Command of "O×AA", followed by "O×OO" "O×OO", follow the steps shown in Table 19. This command will cause the device to exit Standby Mode and enter Operating Mode. At the conclusion of the measurement cycle, the device will automatically re-enter Standby Mode.

| | DUTPUTN | TABLE 19. SPI OUTPUT MEASUREMENT COMMAND | | | | | |
|--|--|---|--|---|--|---|---|
| | | | | Action | | | Notes |
| The data | a on MISO | depend on | the preced | ling comm | and. Discar | d the data on the MISO line. | Master to Sensor |
| | OxAA | 0x00 | 0x00 | | | | |
| MOSI | Command other than NOP | CmdData <15:8> | CmdData <7:0> | | | | Sensor to Master |
| MISO | Status | Data | Data | | | | |
| - | | | - | | | Option 3: Wait for the EOC | NOP Command is "0×F0". |
| | g in the Sta | atus Byte | | | onversion | indicator. | 0 1 0 . |
| clears. | 0xF0 | | to occur. | | | | |
| MOSI | Command | | | | | | |
| l | = NOP | | | | | | |
| MISO | Status | | | | | | |
| To read the 24-bit pressure output along with the 8-bit Status Byte: | | | | | | | |
| [| 0xF0 | 0x00 | 0x00 | 0x00 |] | | |
| MOSI | Command = NOP | 00 _{Hex} | 00 _{Hex} | 00 _{Hex} | | | |
| міso | Status | | | | | | |
| | MOSI [MISO [Option 3 ousy flag clears. [MOSI [MOSI [MOSI [| OxAA MOSI Command other than NOP MISO Status Option 1: Wait unt ousy flag in the Status OxFO MOSI Command = NOP MISO Status MOSI Command = NOP MISO Status To read the 24-bit OxFO MOSI Command = NOP | OxAA OxOO MOSI Command other than CmdData <15:8> MISO Status Data Option 1: Wait until the busy flag in the Status Byte clears. OxFO MOSI Command = NOP MISO Status MISO Status MISO Status MISO Status MISO Command = NOP MOSI Command = NOP MOSI Command = NOP | OxAA OxOO OxOO MOSI Command other than NOP CmdData <15:8> CmdData <7:0> MISO Status Data Data Option 1: Wait until the busy flag in the Status Byte clears. Option 2 5 ms for to occur. MISO Command = NOP Status MISO Status Over the status of the statu | Intervision of the preceding command 0xAA 0x00 0x00 MOSI Command other than NOP CmdData CmdData <15:8> CmdData <7:0> MISO Status Data Data Option 1: Wait until the pousy flag in the Status Byte clears. OxFO OxFO MISO Status Data Data MISO Status Data Data Option 1: Wait until the pousy flag in the Status Byte clears. OxFO OxFO MISO Status Status Status MISO Status Status Status MISO Status OxFO OxOO OxOO MISO Status Status OxFO OxOO OxOO MISO Status Status Output along with the Status of the Statu | The data on MISO depend on the preceding command. Discar OxAA 0x00 0x00 MOSI Command other than CmdData (T5:8) C7:0> MISO Status Data Data Option 1: Wait until the pusy flag in the Status Byte clears. OxFO OxFO MISO Status Output the status Byte clears. OxFO MISO Status Output the status byte clears. OxFO MISO Status Output the status byte clears. OxFO MISO Status OxFO OxOO MISO Status Output the status byte clears. OxFO MISO Status Output the status byte clears. OxFO MISO Status Output the status byte clears. Status Fo read the 24-bit pressure output along with the 8-bit Status OxFO OxOO MISI Command = NOP OO _{Hex} OO _{Hex} OO _{Hex} MISI SensorDat SensorDat SensorDat SensorDat | The data on MISO depend on the preceding command. Discard the data on the MISO line. OxAA OxOO MOSI Command NOP Option 1: Wait until the busy flag in the Status Byte clears. Option 2: Wait for at least 5 ms for the data conversion to occur. Option 3: Wait for the EOC indicator. MISO Status Oata Option 2: Wait for at least 5 ms for the data conversion to occur. Option 3: Wait for the EOC indicator. MISO Status OxFO OxOO OxOO MISO Status Over the data conversion to occur. Option 3: Wait for the EOC indicator. Indicator. MISO Status OxFO OxOO OxOO Indicator. MISO Status Over the s-bit Status Byte: OxFO OxOO OxOO OxOO MOSI Command = NOP OO_Hex OO_Hex OO_Hex MISO Status SensorDat SensorDat SensorDat |

7.6 SPI Timing and Level Parameters (See Table 20.)

TABLE 20. SPI BUS TIMING DIAGRAM AND PARAMETERS

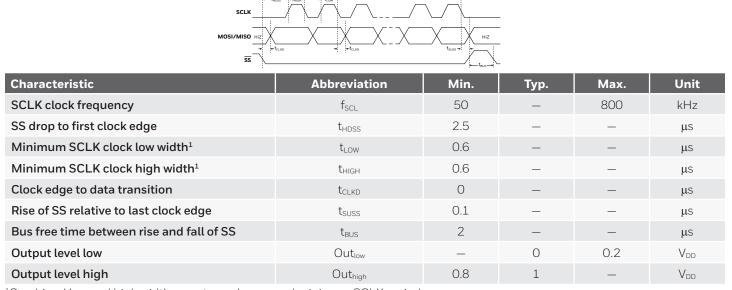

¹Combined low and high widths must equal or exceed minimum SCLK period.

7.7 Reference Code (Arduino/Genuino Uno) for SPI Interface

See also Section 8.0 for details and examples of MPR Series Pressure output calculations.

```
#include<Arduino.h>
#include<SPT.h>
double press counts = 0; // digital pressure reading [counts]
double pressure = 0; // pressure reading [bar, psi, kPa, etc.]
double outputmax = 15099494; // output at maximum pressure [counts]
double outputmin = 1677722; // output at minimum pressure [counts]
double pmax = 1; // maximum value of pressure range [bar, psi, kPa, etc.]
double pmin = 0; // minimum value of pressure range [bar, psi, kPa, etc.]
double percentage = 0; // holds percentage of full scale data
char printBuffer[200], cBuff[20], percBuff[20], pBuff[20];
void setup() {
  Serial.begin(9600);
 while (!Serial) {
    delay(10);
  }
  sprintf(printBuffer, "\nStatus Register, 24-bit Sensor data, Digital Pressure Counts,\
  Percentage of full scale pressure, Pressure Output\n");
  Serial.println(printBuffer);
  SPI.begin();
  pinMode(10, OUTPUT); // pin 10 as SS
  digitalWrite(10, HIGH); // set SS High
void loop() {
  delay(1);
 while (1) {
    uint8_t data[4] = {0xFA, 0x00, 0x00, 0x00}; // holds output data
    uint8_t cmd[3] = {0xAA, 0x00, 0x00}; // command to be sent
    SPI.beginTransaction(SPISettings(200000, MSBFIRST, SPI MODE0)); //SPI at 200kHz
    digitalWrite(10, LOW); // set SS Low
    SPI.transfer(cmd, 3); // send Read Command
    digitalWrite(10, HIGH); // set SS High
    delay(10); // wait for conversion
    digitalWrite(10, LOW);
    SPI.transfer(data, 4);
    digitalWrite(10, HIGH);
    SPI.endTransaction();
    press counts = (double)((int32 t)data[3]+(int32 t)data[2]*(int32 t)256+
    (int32 t)data[1]*(int32 t)65536); // calculate digital pressure counts
    percentage = (press counts / 16777215) * 100; // calculate pressure as percentage of full scale
    //calculation of pressure value according to equation 2 of datasheet
    pressure = ((press counts - outputmin) * (pmax - pmin)) / (outputmax - outputmin) + pmin;
    dtostrf(press counts, 4, 1, cBuff);
    dtostrf(percentage, 4, 3, percBuff);
    dtostrf(pressure, 4, 3, pBuff);
    /*
      The below code prints the raw data as well as the processed data
      Data format : Status Register, 24-bit Sensor Data, Digital Counts, percentage of full scale
pressure, pressure output
    */
    sprintf(printBuffer, "%x\t%2x %2x %2x\t%s\t%s\t%s\n", data[0], data[1], data[2], data[3],
            cBuff, percBuff, pBuff);
    Serial.print(printBuffer);
    delay(10);
  }
}
```

8.0 MPR SERIES SENSOR OUTPUT PRESSURE CALCULATION

The MPR Series sensor output can be expressed by the transfer function of the device as shown in Equation 1:

Equation 1: Pressure Sensor Transfer Function

 $Output = \frac{Output_{max.} - Output_{min.}}{P_{max.} - P_{min.}} * (Pressure - P_{min.}) + Output_{min.}$

Rearranging this equation to solve for Pressure, we get Equation 2:

Equation 2: Pressure Output Function

Pressure = $\frac{(Output - Output_{min.}) * (P_{max.} - P_{min.})}{Output_{max.} - Output_{min.}} + P_{min.}$

Where:

Output_{max.} = output at maximum pressure [counts] Output_{min.} = output at minimum pressure [counts] P_{max.} = maximum value of pressure range [bar, psi, kPa, etc.] P_{min.} = minimum value of pressure range [bar, psi, kPa, etc.] Pressure = pressure reading [bar, psi, kPa, etc.] Output = digital pressure reading [counts]

Example: Calculate the pressure for a -1 psi to 1 psi gage sensor with a 10 % to 90 % calibration, and a pressure output of 14260634 (decimal) counts:

Output_{max.} = 15099494 counts (90 % of 2^{24} counts or 0×E66666) Output_{min.} = 1677722 counts (10 % of 2^{24} counts or 0×19999A) P_{max.} = 1 psi P_{min.} = -1 psi Pressure = pressure in psi Output = 14260634 counts


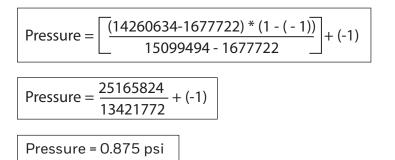


Figure 10. Long Port and Recommended PCB Pad Layout Dimensions (For reference only: mm [in].)

Sensor

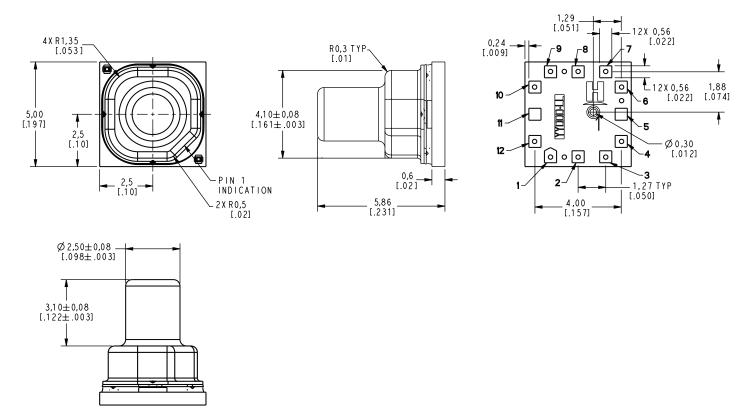

Recommended PCB pad layout




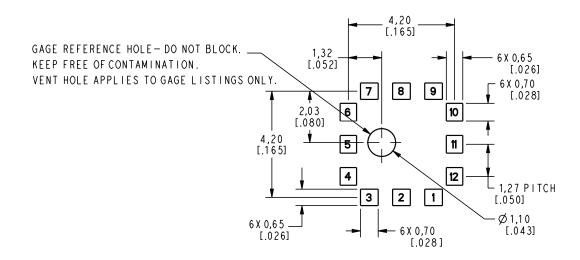


Figure 11. Short Port and Recommended PCB Pad Layout Dimensions (For reference only: mm [in].)




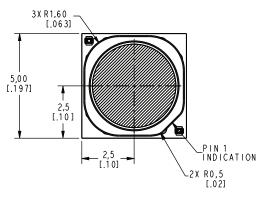


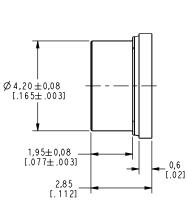

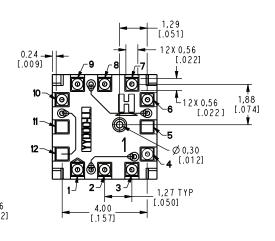


Reflowable protective silicone cap

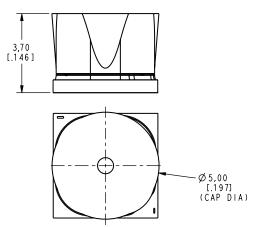

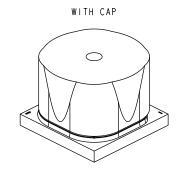



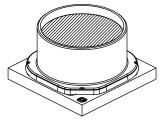

Recommended PCB pad layout


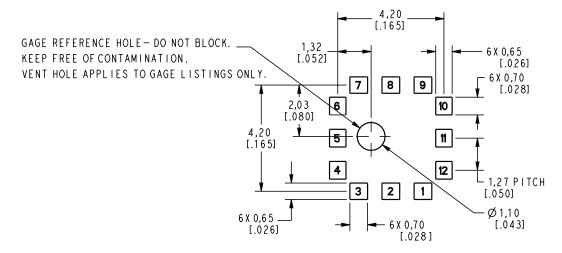


Figure 12. Tape and Reel Dimensions (For reference only: mm.)



Reel

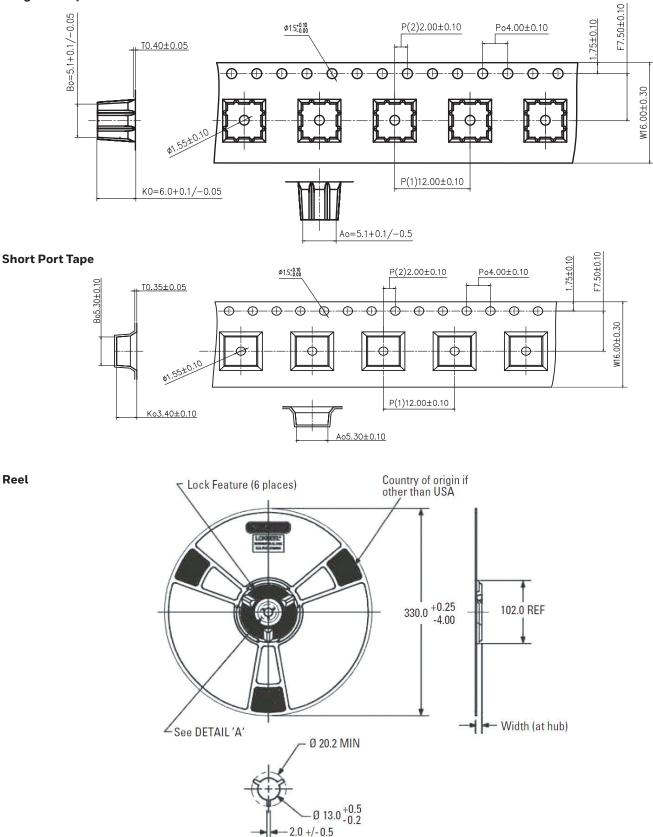

DETAIL 'A'

Reflowable Protective Silicone Cap

Every short port MPR Series sensor is shipped with a reflowable protective silicone cap intended to protect the sensor's protective gel throughout the assembly process (see Figure 10). This cap can withstand lead-free, reflow temperatures and is intended to be removed after the enduser has completed assembly of the MPR sensor to the mating assembly.

Reflowable Protective Silicone Cap Removal

Removal of the cap may easily be done manually using ESDsafe tweezers; however, if possible, and to eliminate possible sensor protective gel damage, the cap removal process should be done in a semi-automated or automated manner. If the cap must be removed manually, follow this removal process:

- Using ESD-safe tweezers, grasp the silicone cap midway up the straight port and lift the cap up vertically until it is no longer supported by the sensor housing.
- At this point, stop the vertical movement and relieve the grasp of the tweezers.
- Regrasp the cap in the unsupported area and continue the vertical movement until the cap is free and clear of the sensor's protective gel.
- Ensure that the sensor's protective gel is not damaged during the cap removal process.

Recommended Tubing

See Table 21 for recommended tubing information.

Recommended O-rings

For O-Ring location, size and recommended part numbers, see the following:

- Short port sensor: Figure 13 and and Table 22.
- Long port sensor: Figure 14 and Table 23.

| TABLE 21. RECOMMENDED TUBING | | | | | | |
|------------------------------|---------------------------|-------------|------------|------------|---------------------------|--|
| Manufacturer | Туре | Part Number | ID (in) | OD (in) | Pressure at 25°C (psi) | |
| Frelin-Wade | Fre-Thane® (polyurethane) | 1A-156-11 | 0.093 | 0.156 | 210 | |
| Frelin-Wade | nylon | 1A-200-01 | 0.093 | 0.125 | 270 | |
| NewAge Industries | PVC | 1100225 | 0.094 | 0.156 | 42 | |
| NewAge Industries | silicone | 2800315 | 0.094 | 0.156 | 20 | |


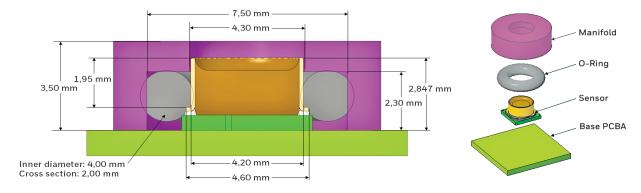


Figure 13. Recommended Manifold Design for Short Port Sensor with O-Ring

| TABLE 22. | TABLE 22. RECOMMENDED O-RINGS FOR SHORT PORT SENSOR | | | | | | |
|------------|---|----------|-------------|------------------------|---------------|--|--|
| ID (mm) | Cross Section (Width) (mm) | Supplier | Part Number | Material | Hardness | | |
| 4.00 | 2.00 | McMaster | 9262K163 | Buna-N | Durometer 70A | | |
| 4.00 | 2.00 | McMaster | 1174N421 | Buna-N | Durometer 50A | | |
| 4.00 | 2.00 | McMaster | 1185N82 | Viton® Fluoroelastomer | Durometer 75A | | |
| 4.00 | 2.00 | McMaster | 9263K163 | Viton® Fluoroelastomer | Durometer 75A | | |
| 4.00 | 2.00 | McMaster | 5233T47 | silicone | Durometer 70A | | |
| 4.00 | 2.00 | McMaster | 1295N222 | Viton® Fluoroelastomer | Durometer 75A | | |
| 4.00 | 2.00 | McMaster | 1278N15 | Kalrez 4079 | Durometer 75A | | |

Figure 14. Recommended Manifold Design for Long Port Sensor with O-Ring

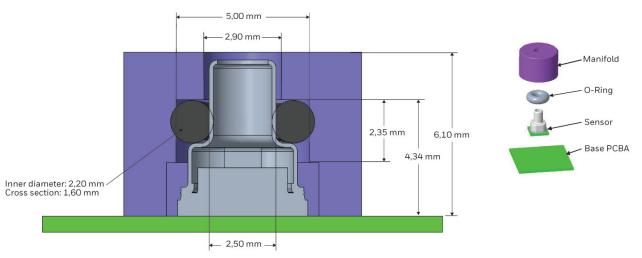

| TABLE 23. RECOMMENDED O-RINGS FOR LONG PORT SENSOR | | | | | | |
|--|-------------------------------|----------|-------------|------------------------|---------------|--|
| ID (mm) | Cross Section (Width) (mm) | Supplier | Part Number | Material | Hardness | |
| 2.20 | 1.60 | McMaster | 9262K131 | Buna-N | Durometer 70A | |
| 2.20 | 1.60 | McMaster | 9263K131 | Viton® Fluoroelastomer | Durometer 75A | |
| 2.20 | 1.60 | McMaster | 5233T142 | silicone | Durometer 70A | |

A WARNING PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

WARNING MISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. The Honeywell standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgment or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While Honeywell may provide information or engineering support for its products through Honeywell personnel, literature and website, it is the buyer's sole responsibility to determine the suitability of the Honeywell product(s) for the buyer's requirements

Specifications may change without notice. The information we supply is believed to be accurate as of this writing. However, Honeywell assumes no responsibility for its use.

For more information

Honeywell Sensing Solutions services its customers through a worldwide network of sales offices and distributors. For application assistance, current specifications, pricing, or the nearest Authorized Distributor, visit automation.honeywell.com/hss or call:

| USA/Canada | +302 613 4491 |
|---------------|---------------------|
| Latin America | +1 305 805 8188 |
| Europe | +44 1344 238258 |
| Japan | +81 (0) 3-6730-7152 |
| Singapore | +65 6355 2828 |
| Greater China | +86 4006396841 |

Honeywell Sensing Solutions

830 East Arapaho Road Richardson, TX 75081 www.honeywell.com

32332628-L-EN | L | 03/25 © 2025 Honeywell International Inc. All rights reserved.

Honeywell