
**Summary: For Duct Applications, an issue with FSP-951 Series replacement sensors when used with NDR200(A), FSL751-DNR(A), DNR or DNRW detectors built prior to April 2014.**

**Issue:** Duct detector models NDR200(A), FSL751-DNR(A), DNR or DNRW built prior to April 2014 (date codes 4034 and earlier) cannot accept FSP-951 replacement sensor due to the mechanical design of the cover. To remedy this situation, a replacement sensor cover is needed. Please contact customer service at 1-800-289-3473 to order a cover.

**DUCTCOV** or **DUCTCOVW** are available for purchase for the detector models as shown below.

| **DUCTCOV for duct detector models manufactured prior to April 2014**: | **DUCTCOVW for waterproof detector manufactured prior to April 2014**: |
|---|---|
| FSL-751DNR(A) | DNRW |
| ND-200(A) | |
| DNR | |

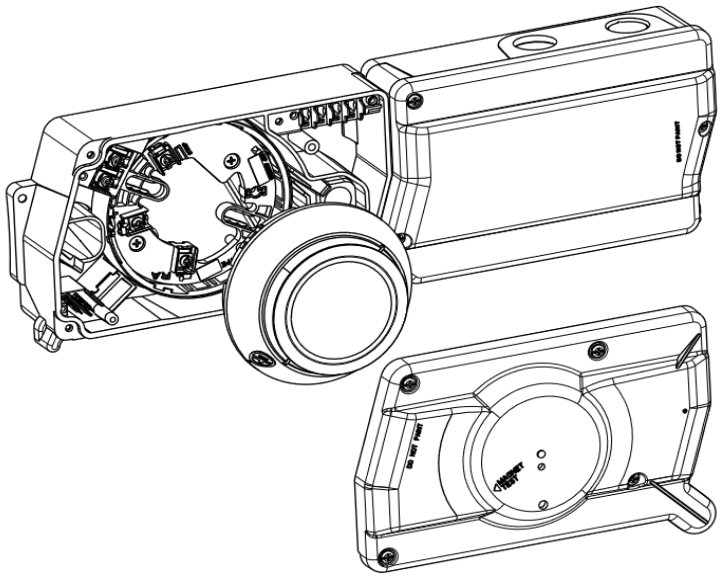

**Installation of the DUCTCOV or DUCTCOVW**

1. Remove the original cover that is located over the sensor head.
2. Replace the FSP-951 Series sensor head following the installation instructions.
3. Install the DUCTCOV / DUCTCOVW using the four screws provided.
4. Follow the installation instructions for proper testing of the FSP-951 Series sensor head.

Please contact our customer service department or your Regional Sales Manager for questions related to purchasing the DUCTCOV or DUCTCOVW. Thank you for your continued support.

© 2019 by NOTIFIER by Honeywell Inc. All rights reserved. | www.notifier.com