# SURECELL™ H2S(L) GAS SENSOR

## Hydrogen Sulfide (H<sub>2</sub>S) Gas Sensor



Hydrogen Sulfide (H<sub>2</sub>S)

Sensor: **H2S(L)** 

Part Number: 2112B2021

#### **DESCRIPTION**

SureCell™ gas sensors are the industry standard for portable gas detectors. The range includes sensors which detect oxygen and toxic gases, and fully certified pellistors for combustible gas detection.

#### **DOCUMENT PURPOSE**

The purpose of this document is to present the performance specification of the SureCell™ H2S(L) gas sensor.

This document should be used in conjunction with Operating Principles (OP08) and the Product Safety Datasheet (PSDS 5.1).

For guidance on the safe use of the sensor, please refer to the Operating Principles.

#### **APPLICATIONS**

- Manufacturing factories
- Refineries
- Food processing
- Drainage and sewage areas
- · Mining processes

#### **PORTFOLIO**

The SureCell™ sensor family is part of the extensive line of Honeywell gas sensors. To learn more about the product, or the many other gas sensors in this series, click here.

## **FEATURES AND BENEFITS**



Industry-leading reliability



Improve performance variability



Fast response time


# **SURECELL™ GAS SENSOR**


# **H2S(L) SERIES**


TABLE 1. TECHNICAL	SPECIFICATIONS	
MEASUREMENT		
Operating principle	3-electrode electrochemical	
Measurement range	0 ppm H <sub>2</sub> S to 200 ppm H <sub>2</sub> S	
Maximum overload	500 ppm H <sub>2</sub> S	
Filter	None	
Sensitivity*	$0.35\mu\text{A/ppm}\pm0.10\mu\text{A/ppm}$	
Response time (T <sub>90</sub> )*	< 10 seconds	
Baseline offset* (clean air)	< ±1.0 ppm equivalent	
Zero shift (-40°C to 50°C)	< ±0.5 ppm equivalent	
Repeatability	< ±5 %	
Linearity	Linear < ±5 %	
ELECTRICAL		
Recommended load resistor	5 Ohm	
Bias voltage	Not required	
MECHANICAL		
Housing material	Noryl N110	
Weight	5 g (approx.)	
Orientation	Any	
ENVIRONMENTAL		
Operating temperature range	Continuous: -20°C to 40°C Intermittent: -40°C to 55°C	
Operating pressure range	1 atm ±10 %	
Operating humidity range	Continuous: 15 %RH to 90 %RH, non-condensing Intermittent: 0 %RH to 99 %RH, non-condensing	
INTRINSIC SAFETY DATA		
Maximum at 500 ppm	0.2 mA	
Maximum o/c voltage	0.8 V	
Maximum s/c current	< 1.0 A	
LIFETIME		
Long-term output drift	< 2 % per month	
Recommended storage temperature	10 °C to 30°C	
Expected operating life	2 years in air	

<sup>\*</sup>Specifications are valid at 20°C, 50 %RH, and 1013 mBar using Honeywell recommended circuitry. Performance characteristics outline the performance of sensors supplied within the first three months. Output signal can drift below the lower limit over time.

#### **Product Dimensions**

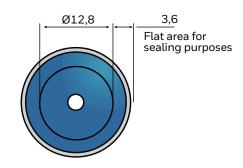

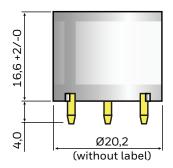

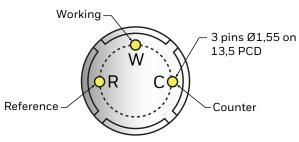

All dimensions in mm All tolerances  $\pm 0,15$  mm unless otherwise stated

#### **IMPORTANT NOTES**

Connection should be made via PCB sockets only. Soldering to the pins will seriously damage your sensor and invalidate the warranty.

## **SURECELL™ GAS SENSOR H2S(L) SERIES**

#### **Poisoning**

SureCell<sup>™</sup> is designed for operation in a wide range of environments and harsh conditions. However, it is important that exposure to high concentrations of solvent vapours is avoided, both during storage, fitting into instruments and operation.

When using sensors with printed circuit boards (PCBs), degreasing agents should be used before the sensor is fitted. Do not glue directly on or near the SureCell sensor as the solvent may cause crazing of the plastic.

#### **Cross-Sensitivity Table**

Whilst SureCells<sup>™</sup> are designed to be highly specific to the gas they are intended to measure, they will still respond to some degree to various other gases. The table below is not exclusive and other gases not included in the table may still cause a sensor to react.

IMPORTANT NOTE: The cross sensitivity data shown below does not form part of the product specification and is supplied for guidance only. Values guoted are based on tests conducted on a small number of sensors and any batch may show significant variation. For the most accurate measurements, an instrument should be calibrated using the gas under investigation.

TABLE 3. CROSS SENSITIVITY		
Gas	Concentration used (ppm)	Equivalent reading (ppm H <sub>2</sub> S)
Ammonia, NH <sub>3</sub>	50	0
Carbon Dioxide, CO <sub>2</sub>	5000	0
Carbon Monoxide, CO	100	< 2
Chlorine, Cl <sub>2</sub>	0.5	0
Ethylene, C <sub>2</sub> H <sub>4</sub>	100	0
Hydrogen, H <sub>2</sub>	100	0
Hydrogen Sulfide, H <sub>2</sub> S	10	10
Nitric Oxide, NO	25	0
Nitrogen Dioxide, NO <sub>2</sub>	3	0
Sulphur Dioxide, SO <sub>2</sub>	2	0

#### WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgment or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.

# 

# The information presented in this product sheet is for reference only. Do not use this document as a

product installation guide.
Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

#### **SAFETY NOTE**

**MISUSE OF** 

DOCUMENTATION

This sensor is designed to be used in safety critical applications. To ensure that the sensor and/or instrument in which it is used, are operating properly, it is a requirement that the function of the device is confirmed by exposure to target gas (bump check) before each use of the sensor and/or instrument. Failure to carry out such tests may jeopardize the safety of people and property.

#### For more information

Honeywell Sensing & Safety Technologies services its customers through a worldwide network of sales offices and distributors. For application assistance, current specifications, pricing, or the nearest Authorized Distributor, visit sps.honeywell.com/ast or call:

USA/Canada +302 613 4491 Latin America +1 305 805 8188 Europe +44 1344 238258 Japan +81 (0) 3-6730-7152 Singapore +65 6355 2828 Greater China +86 4006396841

# Honeywell Sensing & Safety Technologies

830 East Arapaho Road Richardson, TX 75081 www.honeywell.com Sure Cell $^{\mathbb{M}}$  is a trademark or registered trademark of Honeywell International Inc., in the United States and other countries.



