


Model LC

Digital Force Indicator

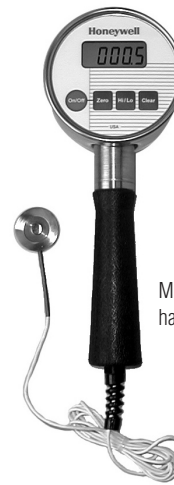

Model LC shown with optional handle.

DESCRIPTION

The Model LC digital force indicator is a highly portable force measurement device. With its 9 V battery supply and compact size the indicator can easily be carried to remote locations to perform force measurement calibrations. The unit can measure compression forces up to 50,000 lbs.

The peak capture feature allows the highest force reading taken to be displayed with the push of a button. The remote location of the load sensor minimizes the chance of damage to the electronic body of the gauge. The stainless steel construction of the sensor and the indicator makes them often resistant to the occasional mishandling than can occur in the field. Optional handles are available for the load cell and gauge.

Each unit has a membrane face with raised buttons and tactile feedback for setup and operation. The high, low, and clear buttons are easily accessible on this front membrane. Zero adjustment and zero offset/tare functions are standard on each unit. Calibration and setup parameters are stored on a memory chip to protect from loss even when power is interrupted. Unauthorized set ups and calibrations are also blocked with internal security. Various combinations of the front panel buttons can be de-activated.

FEATURES

- Ranges to 50000 lb
- Compression measurement
- High/low force capture
- Zero offset/tare
- NIST traceable
- Customer recalibration
- Optional handles and panel mounting ring
- Optional carrying case
- Optional NEMA 4 rating
- Selectable engineering units

Model LC

PERFORMANCE SPECIFICATIONS

Characteristic	Measure
Repeatability	0.2 % of full scale
Range	5 lb to 50000 lb
High and low capture	Standard
Update speed	3 per sec (selectable to 10 per sec)


ELECTRICAL SPECIFICATIONS

Characteristic	Measure
Power	9 V battery, 11 Vdc to 32 Vdc, 100 Vac

MECHANICAL SPECIFICATIONS

Characteristic	Measure
Diameter	93.98 mm [3.7 in]
Display	4½ digits
Case material	Stainless steel
Cell materials	Stainless steel
Zero/span adjustment	Standard
Low battery indication	Standard
Face membrane	Tactile feedback
Calibration data	Stored on memory chip

MOUNTING DIMENSIONS

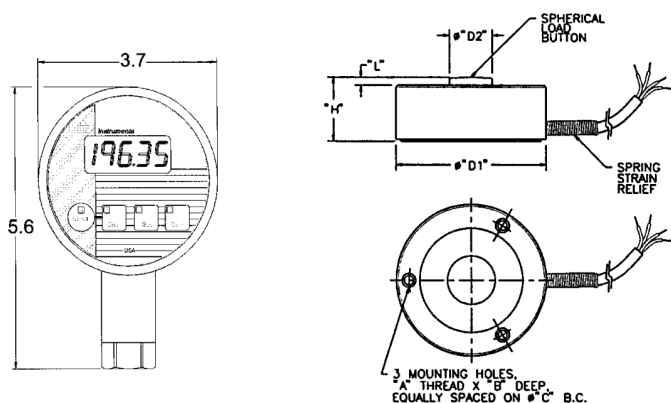

Ranges	D1"	D2"	H"	L"	A"	B"	C"
5, 10, 25, 50, 100 lbs.	1.00	.21	.62	.05	#4-40 UNC	.22	.75
250, 500, 1000, 2000 lbs.	1.25	.32	.39	.07	#6-32 UNC	.25	1.00
3000, 4000, 5000, 7500, 10,000 lbs.	1.50	.43	.63	.08	#6-32 UNC	.25	1.25
15,000, 20,000 lbs.	2.00	.60	1.00	.12	#6-32 UNC	.25	1.625

Specifications subject to change. Request certified drawing before designing mountings or fixtures.

ADDITIONAL SPECIFICATIONS

Pressure range (psi)	Incremental display steps
0 psi to 1 psi (opt) = 1	0.001
0 psi to 5 psi (opt) = 5	0.005
0 psi to 25 psi = 25	0.005
0 psi to 50 psi = 50	0.01
0 psi to 100 psi = 100	0.02
0 psi to 250 psi = 250	0.05
0 psi to 500 psi = 500	0.1
0 psi to 1000 psi = 1K	0.2
0 psi to 2000 psi = 2K	0.5
0 psi to 3000 psi = 3K	2
0 psi to 4000 psi = 4L	2
0 psi to 5000 psi = 5K	1
0 psi to 7500 psi = 7.5K	2
0 psi to 10000 psi = 10K	2
0 psi to 15000 psi = 15K	2
0 psi to 20000 psi = 20K	2
0 psi to 30000 psi = 30K	Consult factory
0 psi to 50000 psi = 50K	Consult factory

ACCESSORIES ORDER CODES

Order code	Accessory
CC2	Standard carrying case: 3 9/16 D x 7 13/16 W x 8 1/2 L
MR2	Panel mounting ring
NISTCERTS	NIST certification (in addition to NIST statement)
HD1	Handle

Model LC

Digital Force Indicator

NOTES

1. Accuracies stated are for best fit straight line for all errors including linearity, hysteresis and repeatability through zero.
2. Consult factory for optional units of measure.
3. Consult factory for optional electrical connectors and cable lengths.

ORDER GUIDE

SERIES LC=0.2% repeatability	LC	W	100	K	Z	()
POWER W=Battery powered (9 V alkaline) T=110 Vac adapter (included) V=11 Vdc to 32 Vdc (3 ft. cable)						
PRESSURE RANGE (lb)						
5=0-5	1K=0-1000	10K=0-10,000				
10=0-10	2K=0-2000	15K=0-15,000				
25=0-25	3K=0-3000	20K=0-20,000				
50=0-50	4K=0-4000	30K=0-30,000				
100=0-100	5K=0-5000	50K=0-50,000				
250=0-250	7.5K=7500					
500=0-500						
REFERENCE K=Compression						
ELECTRICAL CONNECTION Z = No electrical connection C = 3 foot cable T = ac adapter <i>Call factory for availability of other electrical connections and cable lengths.</i>						
UNITS OF MEASURE (Field Selectable) Note: lbs is standard n = Newton Kn = Kilonewton g = Grams Kg = Kilograms <i>Consult factory for other units of measure not listed</i>						
OPTIONAL NEMA 4 CONSTRUCTION 4 = NEMA 4						

This order code is used ONLY if you want NEMA 4 rating.

Warranty. Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items it finds defective. **The foregoing is buyer's sole remedy and is in lieu of all warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.**

While we provide application assistance personally, through our literature and the Honeywell web site, it is up to the customer to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.

For more information about Sensing and Control products, visit www.honeywell.com/sensing or call +1-815-235-6847

Email inquiries to info.sc@honeywell.com

WARNING **PERSONAL INJURY**

- DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

WARNING **MISUSE OF DOCUMENTATION**

- The information presented in this catalogue is for reference only. DO NOT USE this document as product installation information.
- Complete installation, operation and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

Sensing and Control
Automation and Control Solutions
Honeywell
1985 Douglas Drive North
Golden Valley, MN 55422 USA
+1-815-235-6847
www.honeywell.com/sensing

008671-1-EN IL50 GLO
May 2008
Copyright © 2008 Honeywell International Inc. All rights reserved.

Honeywell